



TECHNICAL SERVICE BULLETIN

TSB-C-GN-SP-0029


Date: March 16, 2023

To: All Service and Parts Managers

From: Technical Services Department

Subject: Missing Teflon O-Ring Seals in TXV Kits for Residential Unitary Split Systems

Limited TX*N2 and TX*N4 TXV kits were packaged without the Teflon O-ring seals. **Kits containing Danfoss TXV valves were shipped without the proper O-ring seals** between 11/01/2022 and 03/09/2023. See example below of production date listed on kit label.

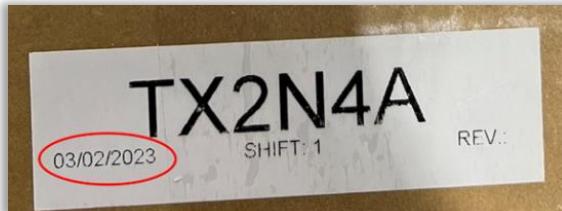

Production Date on Kit Label

Kits containing Emerson TXV valves contain the proper O-rings and are not affected by this issue.
Pictures below show the difference between the two kits.



Danfoss Valve Kit

Emerson Valve Kit

Valve kits with date codes between 11/01/2022 and 03/09/2023 need to be inspected to ensure O-rings are included. Failure to use or replace the O-rings during installation of the valve may result in a refrigerant leak.

Please inspect all kits and if they are missing the O-ring seals, contact your CSR and reference this Technical Service Bulletin (TSB C-GN-SP-0029) to order part #B1796633. The O-ring seals are shipped in a bulk pack of 10 seals and will be sent at no charge.

DAIKIN COMFORT TECHNOLOGIES NORTH AMERICA, INC.

19001 Kermier Road • Waller, TX 77484 • (713) 861-2500 • www.northamerica-daikin.com

Daikin products are subject to continuous improvements. Daikin reserves the right to modify information in the bulletin without notice and without incurring any obligations.

Amana® is a registered trademark of Maytag Corporation or its related companies and is used under license. All rights reserved.